



Compatibility List

a Bridgestone company

LINK 210

Einführung

Diese Liste enthält alle Fahrzeugmodelle, mit denen der LINK 210 kompatibel ist. Die Kompatibilität wird anhand verschiedener Kategorien bewertet:

Unterstützt:

Ja, sofern die OBD-Kommunikation zwischen dem LINK 210 und dem Fahrzeug erfolgreich getestet wurde. Bei einigen Fahrzeugen gibt es besondere Anforderungen in Bezug auf die Kommunikation. Die Konfiguration des LINK 210 muss daher ggf. von unserem Support-Team angepasst werden. Die betreffenden Fahrzeuge sind mit dem Vermerk "Kundensupport kontaktieren" versehen.

Mechanische Kompatibilität: Der OBD-Port befindet sich oft in Bereichen mit begrenztem Platz. Es muss daher geprüft werden, ob der LINK 210 eingepasst werden kann oder ob ein Verlängerungskabel erforderlich ist.

Position des Ports: Fahrzeughersteller haben mehrere Möglichkeiten, den OBD-Port zu positionieren. Die Zahl gibt an, in welchem Bereich der OBD-Port in einem bestimmten Fahrzeugmodell zu finden ist. Die nachfolgende Abbildung zeigt die Nummerierung der verschiedenen Bereiche.



Einführung

Port verdeckt:

Manchmal befindet sich der OBD-Port unter einer Kunststoffkappe oder hinter einer Armaturenbrettverkleidung. Diese Informationen helfen Ihnen, den OBD-Port ausfindig zu machen und den LINK 210 einzubauen.

Kraftstoffverbrauch:

Der LINK 210 berechnet den Kraftstoffverbrauch anhand der Standard-OBD-Daten. Die gemeldeten Kraftstoffverbrauchswerte liefern Einblick in den aktuellen und vergangenen Kraftstoffverbrauch und fließen in die OptiDrive-Bewertung ein, die Aufschluss über das Fahrverhalten gibt. Dieser Kompatibilitätswert gibt an, ob und wie die Berechnung des Kraftstoffverbrauchs unterstützt wird:

 Ja: Das Fahrzeugmodell wurde auf einem Prüfstand getestet und die Ergebnisse wurden verifiziert.

• Ja*: Für diese Fahrzeugmodelle haben wir positives Feedback von unseren Kunden erhalten.

• Sehr Es liegen keine Testergebnisse vor, aber die standardisierte OBD-Kommunikation wahrscheinlich: Lässt darauf schließen, dass der Kraftstoffverbrauch voraussichtlich gemeldet wird.


• Nicht unterstützt: Die Berechnung des Kraftstoffverbrauchs funktioniert bei diesem Fahrzeug nicht.

Der Kommentar ist oft ein zusätzlicher Hinweis zur Position des OBD-Ports im Fahrzeug.



Kommentar:

OBD port locations

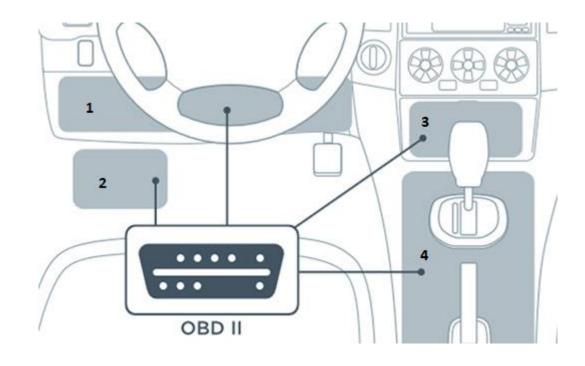



DAAKE.	MODEL	MODEL VEARS	CURRORTER	MECHANICAL	DODT LOCATION	DORT COVERED	FUEL CONCUMENTON	CONADATAIT
MAKE	MODEL	MODEL YEARS	SUPPORTED	FIT	PORTLOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Alfa Romeo	147	2004-2010	Yes	Needs extension cable	1	Yes	Yes*	near fuse box
Alfa Romeo	159	2005-2011	Contact Customer Support	Needs extension cable	2	Yes	Not supported	in fuse box next to driver door, behind cover
Alfa Romeo	Giulia	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Alfa Romeo	Giulietta	2010-	Yes	Unknown	1	Yes	Very likely	under steering wheel
Alfa Romeo	Mito	2008-2010	Yes	Needs extension cable	1	Yes	Very likely	near fuse box
Alfa Romeo	Mito	2010-2016	Yes	Ok	1	Yes	Very likely	near fuse box
Audi	A1	2010-	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	A3	2004-2012	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A3	2012-2016	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A3 sportback	2004-2013	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	A3 sportback	2013-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	A4	2004-2008	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A4	2008-2015	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A4	2015-	Yes	OK	1	No	Yes*	above driver kickpanel, near bonnet release lever
Audi	A5	2008-2016	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A5 sportback	2009-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	A6	2004-2011	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	A6	2011-2018	Yes	Ok	1	No	Yes	above drivers kickpanel
Audi	A8	2009-2017	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	Q2	2016-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	Q3	2011-2018	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	Q5	2008-2016	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	Q5	2017-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	Q7	2006-2015	Yes	Ok	1	No	Yes*	above drivers kickpanel
Audi	π	2006-2014	Yes	Ok	1	No	Very likely	above drivers kickpanel
Audi	π	2014-	Yes	Ok	1	No	Yes	above driver kickpanel



MAKE	MODEL	MODEL YEARS	SLIPPORTED	MECHANICAL	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
IVIAILE	INIODEL	WODELTEARS	3011 OKILD	FIT	TORTEGERIOR	TORTCOVERED	TOLL CONSONII TION	COMMENT
BMW	1-Series	2004-2011	Yes	Ok	2	Yes	Very likely	above kickpanel
BMW	1-Series	2011-	Yes	Needs extension cable	2	Yes	Yes	above kickpanel
BMW	2-Series	2014-	Yes	Ok	1	No	Yes*	above kickpanel
BMW	3-Series	2004-2006	Yes	Needs extension cable	2	Yes	Very likely	above kickpanel
BMW	3-Series	2005-2012	Yes	Needs extension cable	2	Yes	Yes	above kickpanel
BMW	3-Series	2012-	Yes	Ok	1	No	Yes	left side
BMW	4-series	2013-	Yes	Unknown	2	No	Yes	above driver kickpanel, near bonnet release lever
BMW	5-Series	2004-2010	Yes	Ok	2	Yes	Very likely	above kickpanel
BMW	5-Series	2010-2016	Yes	Ok	1	No	Yes	above driver kickpanel, to the left
BMW	5-Series	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, to the left
BMW	5-Series GT	2009-2017	Yes	Ok	1	No	Very likely	above driver kickpanel, to the left
BMW	6-Series	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, to the left
BMW	7-Series	2008-2015	Yes	Ok	1	No	Yes*	above driver kickpanel, to the left
BMW	7-Series	2015-	Yes	Needs extension cable	1	No	Very likely	above driver kickpanel, to the left
BMW	13	2013-	Contact Customer Support	Ok	1	No	Not supported	above driver kickpanel, to the left
BMW	X1	2009-2015	Yes	Ok	2	Yes	Yes*	above kickpanel
BMW	X1	2015-	Yes	Ok	2	Yes	Very likely	above kickpanel
BMW	X2	2018-	Yes	Ok	1	No	Very likely	below driver knee bolster, left side
BMW	Х3	2004-2010	Yes	Needs extension cable	2	Yes	Very likely	plastic cap on OBD port needs to be removed
BMW	Х3	2010-2017	Yes	Needs extension cable	2	Yes	Yes*	plastic cap on OBD port needs to be removed
BMW	X4	2014-	Yes	Unknown	2	Yes	Very likely	above driver kickpanel, near door frame, cover does not close with dongle attached, to close cover remove OBD plastic cap
BMW	X5	2006-2013	Yes	Ok	1	Yes	Yes*	above kick panel - plastic cap on OBD port should be removed
BMW	X5	2013-	Yes	OK	1	No	Yes*	above drivers kickpanel
BMW	X6	2014-	Yes	Ok	1	No	Very likely	above drivers kickpanel



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Chevrolet	Aveo	2011-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Chevrolet	Cruze	2008-2016	Yes	Ok	1	No	Very likely	above drivers kickpanel
Chevrolet	Matiz	2005-2010	Yes	Ok	1	No	Very likely	left side
Chevrolet	Orlando	2010-2018	Yes	Ok	1	No	Very likely	above driver kickpanel, to the left
Chevrolet	Spark	2009-2015	Yes	Ok	1	No	Very likely	left side
Chrysler	300	2011-	Yes	Ok	1	No	Very likely	below driver knee bolster, left side
Citroen	Berlingo	2004-2008	Yes	Ok	1	Yes	Yes*	above fuse box
Citroen	Berlingo	2008-2018	Yes	Needs extension cable	1	Yes	Yes	near fuse box
Citroen	C-Elysee	2013-	Yes	Needs extension cable	1	Yes	Very likely	Undeer big cover on driver knee bolster, cover don't closes with link, adapter cable requied
Citroen	C1	2005-2014	Yes	Ok	1	No	Very likely	above driver kickpanel
Citroen	C1	2014-	Yes	Unknown	1	No	Yes	above driver kickpanel, below steering wheel, above the clutch
Citroen	C2	2004-2010	Yes	Ok	1	Yes	Yes*	near fuse box
Citroen	C3	2004-2009	Yes	Ok	1	Yes	Very likely	near fuse box
Citroen	C3	2009-2017	Yes	Ok	1	Yes	Yes*	near fuse box
Citroen	C3	2017-	Yes	Needs extension cable	1	Yes	Very likely	near fuse box, behind dashboard cover
Citroen	C3 Picasso	2009-2017	Yes	Needs extension cable	5	No	Very likely	near general electric controls
Citroen	C3 Pluriel	2004-2009	Contact Customer Support	Ok	1	Yes	Not supported	near fuse box, next to steering wheel, behind dashboard cover
Citroen	C4	2004-2010	Yes	Needs extension cable	3	Yes	Yes*	behind ashtray
Citroen	C4	2010-2018	Yes	Ok	3	Yes	Yes	above cigarette lighter adapter (CLA)
Citroen	C4 Cactus	2014-	Yes	Needs extension cable	1	Yes	Very likely	near fuse box, behind dashboard cover, cover does not close with dongle attached, extension cable fix the problem
Citroen	C4 Picasso	2006-2013	Yes	Needs extension cable	1	Yes	Very likely	near fuse box, behind dashboard cover
Citroen	C4 Picasso	2013-	Yes	Needs extension cable	1	Yes	Very likely	below steering wheel
Citroen	C4 Grand Picasso	2006-2013	Yes	Ok	5	No	Very likely	in glove box



				MECHANICAL				
MAKE	MODEL	MODEL YEARS	SUPPORTED	FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Citroen	C5	2004-2008	Contact Customer Support	Needs extension cable	3	Yes	Not supported	behind cover in the dashboard, close to driver door
Citroen	C5	2008-2017	Yes	Ok	3	Yes	Very likely	in armrest, remove cover in armrest for install, keep cover removed to close armrest
Citroen	C8	2004-2014	Yes	Ok	1	No	Very likely	below steering wheel in oddments compartment
Citroen	DS3	2010-2016	Yes	Needs extension cable	2	Yes	Very likely	Next to steering wheel
Citroen	DS4	2010-2018	Yes	Needs extension cable	3	Yes	Very likely	above cigarette lighter adapter (CLA)
Citroen	DS5	2011-2015	Yes	Ok	3	Yes	Very likely	in armrest
Citroen	Jumper	2006-	Yes	Ok	1	Yes	Yes*	near fuse box
Citroen	Jumpy	2006-2016	Yes	Ok	1	Yes	Yes*	under steering wheel
Citroen	Nemo	2007-2015	Yes	Ok	1	Yes	Yes*	above driver kickpanel, near fuse box, left of steering wheel, behind dashboard cover
Citroen	Xsara	2004-2006	Yes	Ok	1	Yes	Very likely	near fuse box
Citroen	Xsara Picasso	2004-2010	Yes	Ok	5	Yes	Very likely	glove box
Dacia	Dokker	2012-	Yes	Needs extension cable	1	Yes	Yes*	near fuse box
Dacia	Duster	2010-2018	Yes	Ok	5	Yes	Yes*	with small OBD cap in glove box
Dacia	Logan	2004-2013	Yes	Ok	5	Yes	Yes*	with small OBD cap in glove box
Dacia	Logan	2013-	Yes	Ok	5	Yes	Very likely	with small OBD cap in glove box
Dacia	Logan MCV	2007-2012	Yes	Ok	5	Yes	Very likely	with small OBD cap in glove box
Dacia	Logan MCV	2013-	Yes	Ok	5	Yes	Very likely	with small OBD cap in glove box
Dacia	Sandero	2008-2012	Yes	Ok	5	Yes	Very likely	with small OBD cap in glove box
Dacia	Sandero	2013-	Yes	Ok	5	Yes	Yes*	with small OBD cap in glove box
Daihatsu	Sirion	2007-2012	Yes	Ok	1	No	Very likely	above driver kickpanel
Fiat	500	2008-	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel
Fiat	500C	2009-	Yes	Ok	1	Yes	Very likely	above driver kickpanel
Fiat	500L	2012-	Yes	Ok	1	No	Very likely	above driver kickpanel
Fiat	Bravo	2007-2014	Yes	Ok	1	Yes	Very likely	near fuse box



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Fiat	Croma	2005-2011	Contact Customer Support	Needs extension cable	2	Yes	Not supported	behind dashboard cover, close to driver door
Fiat	Doblo	2000-2006	Yes	Needs extension cable	2	Yes	Very likely	behind dashboard cover, close to driver door
Fiat	Doblo	2006-2009	Yes	Ok	1	Yes	Very likely	near fuse box
Fiat	Doblo	2010-	Yes	Ok	1	Yes	Yes	near fuse box
Fiat	Ducato	2004-2006	Contact Customer Support	Needs extension cable	1	Yes	Not supported	behind dashboard cover, close to bonnet release lever
Fiat	Ducato	2006-2014	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, left of steering wheel, in fuse box, access with screw driver
Fiat	Ducato	2014-	Yes	Needs extension cable	1	Yes	Very likely	behind fuse box cover
Fiat	Grande Punto	2005-2009	Yes	Needs extension cable	1	Yes	Very likely	On left side under fuses cover
Fiat	Fiorino	2008-	Yes	Needs extension cable	1	Yes	Very likely	near fuse box, next to steering wheel, behind dashboard cover
Fiat	Freemont	2011-2016	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Fiat	Linea	2007-2018	Yes	Needs extension cable	1	Yes	Very likely	near fuse box, next to steering wheel, behind dashboard cover
Fiat	Panda	2004-2012	Yes	Ok	1	Yes	Yes*	near fuse box
Fiat	Panda	2012-	Yes	Ok	1	Yes	Very likely	near fuse box
Fiat	Punto	2004-2006	Yes	Ok	1	Yes	Very likely	below fuse box
Fiat	Punto	2005-2018	Yes	Needs extension cable	1	Yes	Very likely	near fuse box. Cannot be fully closed with device attached
Fiat	Qubo	2008-	Yes	Ok	1	Yes	Very likely	near fuse box
Fiat	Scudo	2007-2016	Yes	Ok	1	Yes	Yes	in the side of the dashboard compartment below steering wheel
Fiat	Stilo	2004-2007	Yes	Ok	1	Yes	Very likely	near fuse box
Fiat	Talento	2016-	Yes	Needs extension cable	1	Yes	Very likely	On left side under fuses cover
Fiat	Tipo	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Ford	B-Max	2012-2017	Yes	Needs extension cable	1	Yes	Very likely	left/below steering column



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Ford	C-Max	2004-2010	Yes	Ok	1	No	Yes	in an oddments tray
Ford	C-Max	2010-2019	Yes	Ok	1	Yes	Yes	above driver kickpanel
Ford	F-150 Raptor	2008-2014	Yes	Ok	1	No	Very likely	above kickpanel
Ford	Fiesta	2004-2008	Yes	Ok	1	Yes	Yes*	above kickpanel
Ford	Fiesta	2008-2016	Yes	Ok	1	Yes	Yes	above kickpanel
Ford	Fiesta	2016-	Yes	Ok	1	Yes	Very likely	below driver knee bolster, left side with cover, cover don't close
Ford	Focus	2004-2010	Contact Customer Support	Ok	1	No	Not supported	above kickpanel
Ford	Focus	2011-2017	Yes	Needs extension cable	1	Yes	Yes	above kickpanel
Ford	Fusion	2004-2012	Yes	Needs extension cable	1	Yes	Very likely	above kickpanel
Ford	Galaxy	2006-2014	Yes	Needs extension cable	2	Yes	Yes*	next to steering wheel
Ford	Galaxy	2014-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Ford	Ka	2004-2008	Yes	Ok	2	Yes	Very likely	near kickpanel
Ford	Ka	2008-2016	Yes	Ok	1	Yes	Very likely	above kickpanel
Ford	Ka+	2017-	Yes	ОК	1	No	Very likely	above driver kickpanel, above brake pedal
Ford	Kuga	2008-2013	Yes	Ok	1	No	Very likely	above kickpanel
Ford	Kuga	2013-	Yes	Needs extension cable	1	Yes	Yes*	above driver kickpanel, left of steering wheel, behind dashboard cover
Ford	Mondeo	2004-2007	Yes	Needs extension cable	1	Yes	Yes*	above driver kickpanel, above accelerator pedal, possible obstruction for driver, extension cable needed, professional installation needed
Ford	Mondeo	2007-2014	Yes	Needs extension cable	1	Yes	Yes	next to steering wheel
Ford	Mondeo	2014-	Yes	Ok	1	Yes	Very likely	above driver kickpanel, near bonnet release lever
Ford	Mustang	2015-	Yes	Ok	1	No	Very likely	OBD location on the left
Ford	Ranger	2011-	Yes	Ok	1	Yes	Yes*	above kickpanel
Ford	S-Max	2006-2015	Yes	Needs extension cable	1	Yes	Very likely	next to steering wheel
Ford	S-Max	2015-	Yes	ОК	1	No	Very likely	above driver kickpanel, near bonnet release lever



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Ford	Tourneo Connect	2013-	Yes	Ok	1	Yes	Yes	above drivers kickpanel
Ford	Tourneo Custom	2013-	Yes	Needs extension cable	1	Yes	Yes	above drivers kickpanel
Ford	Transit	2000-2006	Contact Customer Support	Ok	1	Yes	Not supported	below steering wheel, behind dashboard cover next to driver door
Ford	Transit	2006-2013	Contact Customer Support	Ok	1	Yes	Not supported	below steering wheel, behind dashboard cover next to driver door
Ford	Transit	2014-	Yes	Ok	1	Yes	Yes	below/left of steering column
Ford	Transit Connect	2004-2013	Yes	Needs extension cable	1	Yes	Yes	left of steering wheel
Ford	Transit Connect	2013-	Yes	Ok	1	Yes	Yes	above drivers kickpanel
Ford	Transit Courier	2014-	Yes	Needs extension cable	1	Yes	Yes*	above driver kickpanel, next to steering wheel, behind dashboard cover
Ford	Transit Custom	2013-	Yes	Needs extension cable	1	Yes	Yes	above drivers kickpanel
Honda	Accord	2004-2008	Yes	Ok	1	No	Yes	above the clutch
Honda	Accord	2008-2015	Yes	Ok	1	No	Yes	above the clutch
Honda	Civic	2004-2006	Yes	Ok	1	No	Very likely	above kickpanel
Honda	Civic	2006-2011	Yes	Ok	1	No	Very likely	above kickpanel
Honda	Civic	2012-2017	Yes	Ok	1	No	Yes	above kickpanel
Honda	CR-V	2007-2012	Yes	Ok	1	No	Very likely	above kickpanel
Honda	CR-V	2012-2018	Yes	Ok	1	No	Very likely	above kickpanel
Honda	HR-V	2004-2006	Yes	Ok	1	No	Very likely	above kickpanel
Honda	HR-V	2015-	Yes	ОК	1	No	Very likely	right side of driver knee bolster, below accelerator pedal
Honda	Jazz	2004-2008	Yes	Ok	1	No	Very likely	above kickpanel
Honda	Jazz	2009-2015	Yes	Ok	1	No	Very likely	near center console
Honda	Jazz	2015-	Yes	Ok	1	No	Yes	above kickpanel
Honda	S2000	2004-2009	Yes	ОК	1	No	Very likely	above driver kickpanel, near center console



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Hyundai	Accent	2004-2005	Yes	Ok	1	No	Very likely	above kickpanel
Hyundai	Atos	2004-2008	Yes	Ok	1	No	Very likely	above driver kickpanel, above accelerator pedal
Hyundai	Elantra	2015-	Yes	Needs extension cable	1	Yes	Very likely	above driver kickpanel, near fuse box, next to steering wheel, behind dashboard cover, cable needed
Hyundai	Getz	2004-2009	Yes	Ok	1	No	Very likely	above kickpanel
Hyundai	110	2008-2013	Yes	Ok	1	No	Very likely	above kickpanel
Hyundai	I10	2013-	Yes	Ok	1	Yes	Yes	above kickpanel
Hyundai	120	2008-2014	Yes	Ok	1	Yes	Very likely	above kickpanel
Hyundai	i20	2014-	Yes	Needs extension cable	1	Yes	Very likely	above driver kickpanel, in fuse box, behind dashboard cover
Hyundai	130	2007-2012	Yes	Ok	1	No	Yes	above kickpanel
Hyundai	130	2012-2017	Yes	Ok	1	No	Yes	above drivers kickpanel
Hyundai	130	2017-	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, near fuse box, next to steering wheel, behind dashboard cover, cable fix the problem
Hyundai	i40	2011-2017	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, near fuse box, behind dashboard cover
Hyundai	ix20	2010-	Yes	Ok	1	No	Very likely	above driver kickpanel
Hyundai	ix35	2010-2015	Yes	Ok	1	No	Very likely	above drivers kickpanel
Hyundai	Kona	2017-	Yes	Unknown	1	Yes	Very likely	above driver kickpanel, above the clutch, cover does not close with dongle attached
Hyundai	Santa Fe	2012-2018	Yes	Needs extension cable	1	Yes	Very likely	above driver kickpanel, in fuse box, behind dashboard cover
Hyundai	Tucson	2005-2010	Yes	Ok	1	No	Very likely	above drivers kickpanel
Hyundai	Tucson	2015-	Yes	OK	1	No	Yes	above driver kickpanel, under the dashboard, below steering wheel
Infiniti	Ex	2008-2013	Yes	Ok	1	No	Very likely	under driver knee bolster
Infiniti	G37	2007-2015	Yes	Ok	1	No	Very likely	under driver knee bolster
Infiniti	Q50	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, under the dashboard, below steering wheel
Isuzu	D-Max	2012-	Yes	Ok	1	No	Yes*	above driver kickpanel, right below driving wheel



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Iveco	Daily	2006-2011	Contact Customer Support	Ok	2	Yes	Not supported	in the fuse box (on the left)
Iveco	Daily	2014-2016	Yes	Ok	1	Yes	Very likely	above driver kickpanel, near fuse box, left of steering wheel
Iveco	Daily	2014-	Yes	Ok	2	Yes	Very likely	above driver kickpanel, above the clutch, cover does not close with dongle attached
Jaguar	F-Pace	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel, near center console
Jaguar	X-Type	2001-2009	Contact Customer Support	Ok	1	No	Not supported	above driver kickpanel
Jaguar	XE	2015-	Yes	Ok	1	No	Very likely	above driver kickpanel
Jaguar	XF	2008-2015	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Jaguar	XF	2015-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Jeep	Cherokee	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Jeep	Grand Cherokee	2005-2010	Yes	Ok	1	No	Yes*	above driver kickpanel, near bonnet release lever
Jeep	Renegade	2014-	Yes	Ok	1	No	Yes	above driver kickpanel
Jeep	Wrangler	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Kia	Carens	2002-2006	Yes	Ok	1	No	Very likely	above kickpanel
Kia	Carens	2013-2018	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, near fuse box, behind dashboard cover, cover does not close with dongle attached, cable needed
Kia	Ceed	2007-2012	Yes	Ok	1	No	Yes*	above kickpanel
Kia	Ceed	2012-2018	Yes	Needs extension cable	1	Yes	Yes	above kickpanel
Kia	Optima	2015-	Yes	Unknown	1	Yes	Yes*	above driver kickpanel, in fuse box, behind dashboard cover
Kia	Picanto	2004-2011	Yes	Ok	1	No	Very likely	above kickpanel
Kia	Picanto	2011-2017	Yes	Needs extension cable	1	Yes	Very likely	above kickpanel
Kia	Picanto	2017-	Yes	Needs extension cable	1	Yes	Very likely	above kickpanel
Kia	Rio	2005-2011	Yes	Needs extension cable	1	Yes	Very likely	above driver kickpanel, left of steering wheel, in fuse box, behind dashboard cover
Kia	Rio	2011-2017	Yes	Ok	1	No	Yes	above driver kickpanel, above brake pedal
Kia	Rio	2017-	Yes	Ok	1	No	Yes	above driver kickpanel, above clutch pedal



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Kia	Sorento	2002-2009	Yes	Ok	1	No	Very likely	above kickpanel
Kia	Sorento	2014-	Yes	Unknown	1	Yes	Very likely	above driver kickpanel, near fuse box, behind dashboard cover, cover does not close with dongle attached, cable don't resolve the problem
Kia	Soul	2009-2014	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Kia	Sportage	2010-2015	Yes	Ok	1	No	Very likely	above kickpanel
Kia	Sportage	2016-	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, left of steering wheel, in fuse box, behind dashboard cover, cover does not close with dongle attached
Kia	Venga	2010-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Lancia	Delta	2008-2014	Yes	Ok	1	Yes	Very likely	above driver kickpanel, left of steering wheel, in fuse box, behind dashboard cover
Lancia	Ypsilon	2011-	Yes	Ok	1	Yes	Very likely	left/below steering wheel
Land Rover	Defender	2004-	Yes	Needs extension cable	1	Yes	Yes*	near fuse box
Land Rover	Discovery	2009-2016	Yes	ОК	1	No	Yes*	above driver kickpanel
Land Rover	Discovery	2017-	Yes	Ok	1	No	Very likely	above kickpanel
Land Rover	Freelander	2004-2006	Contact Customer Support	Ok	1	No	Not supported	above kickpanel
Land Rover	Freelander	2006-2014	Yes	Ok	1	No	Yes*	above kickpanel
Land Rover	Range Rover	2002-2012	Yes	Needs extension cable	1	Yes	Yes*	above driver kickpanel, next to steering wheel, in dashboard compartment, cover does not close with dongle attached, out of sight
Land Rover	Range Rover	2012-	Yes	Ok	1	No	Yes*	above driver kickpanel, above the clutch
Land Rover	Range Rover Evoque	2011-2018	Yes	Ok	1	No	Very likely	above kickpanel
Land Rover	Range Rover Sport	2005-2013	Yes	Ok	1	No	Very likely	above kickpanel
Lexus	IS	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Lexus	NX	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Maserati	Ghibli	2013-	Yes	ОК	1	No	Very likely	above driver kickpanel, near bonnet release lever
Mazda	2	2007-2014	Yes	Ok	1	No	Very likely	$above\ driver\ kickpanel, left\ of\ steering\ wheel, in\ dashboard\ compartment$
Mazda	2	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Mazda	3	2004-2009	Yes	Ok	1	No	Very likely	above driver kickpanel, left of steering wheel, in dashboard compartment
Mazda	3	2009-2013	Yes	Ok	1	No	Very likely	above driver kickpanel, left of steering wheel, in dashboard compartment
Mazda	3	2013-2019	Yes	Ok	1	No	Yes	above driver kickpanel, under the dashboard, above the clutch
Mazda	5	2005-2010	Yes	Ok	1	No	Very likely	above driver kickpanel, left of steering wheel, in dashboard compartment
Mazda	6	2002-2007	Yes	Ok	1	No	Very likely	above kickpanel
Mazda	6	2008-2013	Yes	Ok	1	No	Very likely	above kickpanel
Mazda	6	2013-	Yes	Ok	1	No	Yes*	above drivers kickpanel
Mazda	CX-3	2015-	Yes	Ok	1	No	Very likely	above driver kickpanel
Mazda	CX-5	2013-2017	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Mazda	CX-5	2017-	Yes	OK	1	No	Very likely	above driver kickpanel, near bonnet release lever
Mazda	CX-7	2007-2012	Yes	OK	1	No	Very likely	above driver kickpanel, near bonnet release lever
Mazda	CX-9	2006-2016	Yes	Ok	1	No	Very likely	under driver knee bolster
Mazda	MX-5	2006-2015	Yes	Ok	1	No	Very likely	above drivers kickpanel
Mercedes-Benz	A-Class	2004-2012	Yes	Ok	1	Yes	Yes	above kickpanel
Mercedes-Benz	A-Class	2012-	Yes	Ok	1	Yes	Yes	above kickpanel
Mercedes-Benz	B-Class	2005-2011	Yes	Ok	1	Yes	Very likely	above kickpanel
Mercedes-Benz	B-Class	2011-2018	Yes	Ok	1	Yes	Very likely	above kickpanel
Mercedes-Benz	: Citan	2012-	Yes	Ok	4	Yes	Yes	center console, next to cigarette lighter adapter (CLA)
Mercedes-Benz	: CLA	2013-	Yes	Ok	1	Yes	Yes	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	: CLK	2004-2009	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	CLS	2004-2010	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	: CLS	2011-2018	Yes	OK	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Mercedes-Benz	C-Class	2004-2007	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	C-Class	2007-2014	Yes	Ok	1	Yes	Yes	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	C-Class	2014-	Yes	ОК	1	Yes	Yes	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	E-Class	2004-2009	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	E-Class	2009-2016	Yes	Ok	1	Yes	Yes*	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	GL-Class	2006-2012	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	GL-Class	2012-2019	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	GLA	2014-	Yes	Ok	1	Yes	Yes*	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	GLC	2015-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Mercedes-Benz	GLK	2008-2015	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	M-Class	2005-2011	Yes	Ok	1	Yes	Very likely	above the clutch
Mercedes-Benz	ML-Class	2011-2018	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	S-Class	2005-2013	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	S-Class	2013-	Yes	Ok	1	Yes	Yes*	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	Sprinter	2006-2018	Yes	Needs extension cable	1	Yes	Yes	near fuse box
Mercedes-Benz	Sprinter	2018-	Contact Customer Support	Needs extension cable	1	Yes	Not supported	near fuse box
Mercedes-Benz	V-Class	2014-	Yes	Ok	1	Yes	Very likely	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	Vito	2003-2014	Yes	Ok	1	Yes	Yes	above kick panel - small OBD cover does not close
Mercedes-Benz	Vito	2014-	Yes	Ok	1	Yes	Yes	above driver kickpanel, cover does not close with dongle attached, out of sight
Mercedes-Benz	Viano	2003-2014	Yes	Ok	1	Yes	Very likely	above kick panel - small OBD cover does not close



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Mini	Countryman	2010-2017	Yes	Ok	1	No	Very likely	above driver kickpanel
Mini	Countryman	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Mini	Mini	2001-2006	Yes	Needs extension cable	1	Yes	Very likely	above kick panel - small OBD cover does not close
Mini	Mini	2006-2013	Yes	Ok	1	Yes	Yes*	above kick panel - plastic cap on OBD port should be removed
Mini	Mini	2014-	Yes	Ok	1	Yes	Yes*	above kick panel - plastic cap on OBD port should be removed
Mitsubishi	ASX	2010-	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Mitsubishi	Colt	2004-2012	Yes	Ok	1	Yes	Yes*	below steering wheel
Mitsubishi	L200	2006-2015	Yes	Ok	1	No	Yes*	above kickpanel
Mitsubishi	Lancer	2008-2014	Yes	Ok	1	No	Very likely	above driver kickpanel
Mitsubishi	Outlander	2006-2012	Yes	ОК	1	No	Very likely	under driver knee bolster
Mitsubishi	Outlander	2012-	Yes	Ok	1	No	Very likely	above driver kickpanel
Nissan	Almera	2004-2006	Yes	Ok	1	Yes	Very likely	above driver kickpanel
Nissan	Juke	2010-	Yes	Ok	1	Yes	Very likely	below steering wheel
Nissan	Micra	2004-2010	Yes	Needs extension cable	1	Yes	Very likely	next to steering wheel
Nissan	Micra	2010-2017	Yes	Needs extension cable	1	Yes	Very likely	under the steering wheel
Nissan	Micra	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, below steering wheel, above the clutch
Nissan	Murano	2008-2014	Yes	Ok	1	Yes	Very likely	above driver kickpanel
Nissan	Navara	2005-2015	Yes	Ok	1	No	Yes	above accelerator pedal
Nissan	Note	2006-2013	Yes	Needs extension cable	1	Yes	Yes	next to steering wheel
Nissan	Note	2013-	Yes	Ok	1	No	Yes	above kickpanel
Nissan	NV200	2009-	Yes	Ok	1	Yes	Yes*	above driver kickpanel
Nissan	NV400	2010-	Yes	Needs extension cable	1	Yes	Yes	Undeer big cover on driver knee bolster
Nissan	Qashqai	2007-2013	Yes	Needs extension cable	1	Yes	Yes	next to steering wheel
Nissan	Qashqai	2014-	Yes	Needs extension cable	1	Yes	Yes*	next to steering wheel



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Nissan	Pixo	2009-2013	Yes	Ok	1	No	Very likely	above driver kickpanel, near center console
Nissan	Pulsar	2014-2018	Yes	Needs extension cable	1	Yes	Very likely	left of steering wheel, near fuse box, behind dashboard cover
Nissan	Rogue	2013-	Yes	Ok	1	No	Very likely	under driver knee bolster
Nissan	X-Trail	2001-2007	Yes	Needs extension cable	1	Yes	Very likely	next to steering wheel
Nissan	X-Trail	2007-2014	Yes	Ok	1	No	Very likely	under driver knee bolster
Nissan	X-Trail	2014-	Yes	Needs extension cable	1	Yes	Yes*	left of steering wheel, near fuse box, behind dashboard cove
Opel	Adam	2012-	Yes	Ok	1	No	Yes	above driver kickpanel
Opel	Agila	2004-2007	Yes	Ok	1	No	Very likely	underside of the dashboard
Opel	Astra	2004-2010	Yes	Ok	4	Yes	Yes	below handbrake cover
Opel	Astra	2010-2015	Yes	Ok	1	No	Yes	above kickpanel
Opel	Astra	2015-	Yes	Ok	1	No	Yes	above driver kickpanel
Opel	Combo	2001-2011	Yes	Ok	3	No	Yes	middle console
Opel	Combo	2011-2018	Yes	Needs extension cable	3	No	Yes	above driver kickpanel, next to steering wheel, near fuse box, behind dashboard cover
Opel	Combo	2018-	Yes	Needs extension cable	1	Yes	Yes*	under driver knee bolster removed panel, panel don't close with link. Extension cable needed.
Opel	Corsa	2004-2006	Yes	Ok	3	No	Very likely	middle console
Opel	Corsa	2006-2014	Yes	Ok	3	No	Yes	middle console
Opel	Corsa	2014-	Yes	OK	1	No	Yes	above driver kickpanel, above the clutch
Opel	Crossland X	2017-	Yes	Ok	1	No	Very likely	under driver knee bolster, left side
Opel	Grandland X	2017-	Yes	Needs extension cable	1	Yes	Very likely	under driver knee bolster removed panel, on the right side
Opel	Insignia	2008-2017	Yes	Ok	1	No	Yes	above driver kickpanel, above the clutch
Opel	Insignia	2017-	Yes	ОК	1	No	Yes	above driver kickpanel, above the clutch
Opel	Karl	2015-	Yes	Ok		No	Very likely	Under the dashboard, driver side. At the left of the pedals near footrest
Opel	Meriva	2004-2010	Yes	Ok	4	Yes	Very likely	below the handbrake cover
Opel	Meriva	2010-	Yes	Ok	4	Yes	Very likely	between gearshift lever and handbrake



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Opel	Mokka	2012-2019	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Opel	Movano	2010-	Yes	Needs extension cable	1	Yes	Yes	below steering wheel, behind dashboard cover
Opel	Tigra TwinTop	2004-2009	Yes	Ok	3	No	Very likely	center console, below air condition controls, next to cigarette lighter adapter (CLA)
Opel	Vectra	2004-2009	Yes	Needs extension cable	3	Yes	Very likely	under the ashtray
Opel	Vivaro	2001-2014	Yes	Needs extension cable	1	Yes	Yes*	under steering wheel
Opel	Vivaro	2014-	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, next to steering wheel, near fuse box, behind dashboard cover
Opel	Zafira	1999-2005	Yes	Ok	4	Yes	Very likely	below the handbrake cover
Opel	Zafira	2005-2014	Yes	Needs extension cable	4	Yes	Yes	between gearshift lever and handbrake. Cover cannot be fully closed with device attached $$
Opel	Zafira Tourer	2014-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Peugeot	107	2005-2014	Yes	Ok	1	No	Yes	above kickpanel
Peugeot	1007	2004-2009	Yes	Needs extension cable	1	Yes	Very likely	near fuse box
Peugeot	206	2004-2010	Yes	Ok	1	Yes	Yes*	near fuse box
Peugeot	206 Plus	2009-2013	Yes	Ok	1	Yes	Very likely	near fuse box
Peugeot	207	2005-2012	Yes	Needs extension cable	1	Yes	Very likely	near fuse box
Peugeot	208	2012-2019	Yes	Needs extension cable	1	Yes	Yes	below steering wheel, near fuse box, behind dashboard cover, cover does not close with dongle attached, extension cable needed
Peugeot	2008	2013-	Yes	Needs extension cable	1	Yes	Yes	behind dashboard cover
Peugeot	3008	2009-2016	Yes	Needs extension cable	1	Yes	Yes	next to steering wheel
Peugeot	3008	2016-	Yes	Needs extension cable	1	Yes	Yes*	next to steering wheel, near fuse box, behind dashboard cover
Peugeot	301	2012-	Yes	Needs extension cable	1	Yes	Very likely	below steering wheel, near fuse box, behind dashboard cover
Peugeot	307	2004-2008	Yes	Needs extension cable	1	Yes	Very likely	next to steering wheel
Peugeot	307 CC	2004-2008	Yes	Needs extension	3	Yes	Very likely	center consle



	******			MECHANICAL		2027 001/5252		
MAKE	MODEL	MODEL YEARS	SUPPORTED	FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Peugeot	308	2008-2013	Yes	Needs extension cable	3	Yes	Yes	center console
Peugeot	308	2013-	Yes	Ok	3	No	Yes	Near CLA (cigarette lighter adapter)
Peugeot	407	2004-2010	Yes	Ok	4	No	Yes*	in the armrest
Peugeot	5008	2009-2017	Yes	Needs extension cable	5	Yes	Yes	in glove box, cover cannot be applied with device attached
Peugeot	508	2010-2018	Yes	Needs extension cable	3	Yes	Yes	behind the ashtray
Peugeot	807	2004-2008	Yes	Ok	3	Yes	Very likely	in upper part of the cup holder that is in front of and below the gear lever
Peugeot	Bipper	2008-2014	Yes	Needs extension cable	1	Yes	Yes	next to steering wheel, near fuse box, behind dashboard cover
Peugeot	Boxer	2006-2014	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, left of steering wheel, in fuse box, access with screw driver
Peugeot	Boxer	2014-	Yes	Needs extension cable	1	Yes	Yes	behind fuse box cover
Peugeot	Expert	2007-2016	Yes	Needs extension cable	1	Yes	Yes	In oddments tray below steering wheel. Small OBD cap cannot be closed with device attached. Out of sight
Peugeot	Expert	2016-	Yes	Needs extension cable	1	Yes	Very likely	next to steering wheel, in fuse box, behind dashboard compartment
Peugeot	Partner	2004-2008	Yes	Ok	1	Yes	Very likely	next to steering wheel
Peugeot	Partner	2008-2018	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, below cover
Peugeot	RCZ	2010-2015	Yes	Needs extension cable	3	Yes	Very likely	Center console
Porsche	Cayenne	2002-2010	Yes	Needs extension cable	1	Yes	Very likely	above drivers kickpanel
Porsche	Cayman	2004-2013	Yes	Ok	1	No	Very likely	above clutch
Porsche	Cayman	2013-2016	Yes	Needs extension cable	2	Yes	Very likely	left from driver kickpanel, below the door area
Porsche	Macan	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Porsche	Panamera	2009-2016	Yes	OK	1	No	Very likely	under driver knee bolster, left side
Renault	Captur	2013-	Yes	Needs extension cable	3	Yes	Yes	near CLA



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
				FIT				
Renault	Clio II	1998-2012	Yes	Needs extension cable	3	Yes	Very likely	under the ashtray
Renault	Clio III	2005-2014	Yes	Needs extension cable	3	Yes	Yes	underside of center console
Renault	Clio IV	2012-2019	Yes	Needs extension cable	3	Yes	Yes	below oddments tray in center console
Renault	Espace	2004-2015	Yes	Needs extension cable	4	Yes	Very likely	below hand brake
Renault	Espace	2015-	Yes	Ok	4	Yes	Very likely	below center armrest
Renault	Fluence	2009-	Yes	Needs extension cable	3	Yes	Very likely	center console, below lighter, behind cover
Renault	Grand Scenic	2004-2009	Yes	Ok	4	Yes	Yes	under the cupholder cover
Renault	Grand Scenic	2009-2016	Yes	Needs extension cable	4	Yes	Yes	in the center console, undeer rear bootle holder, cable needed
Renault	Kadjar	2015-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Renault	Kangoo	2004-2008	Yes	Needs extension cable	1	Yes	Yes	belowsteeringcolumn
Renault	Kangoo	2008-	Yes	Needs extension cable	4	Yes	Yes	below hand brake
Renault	Koleos	2007-2014	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Renault	Laguna	2000-2007	Yes	Ok	3	Yes	Very likely	under the ashtray
Renault	Laguna	2007-2015	Yes	Ok	4	Yes	Yes*	in the armrest
Renault	Master	2004-2010	Yes	Ok	1	Yes	Yes	in fuse box
Renault	Master	2010-	Yes	Needs extension cable	1	Yes	Yes	in fuse box
Renault	Megane	2002-2009	Yes	Ok	3	Yes	Very likely	bottom of center console
Renault	Megane	2008-2016	Yes	Needs extension cable	3	Yes	Yes	above the ashtray
Renault	Megane	2016-	Yes	Ok	2	No	Very likely	above driver kickpanel, near bonnet release lever
Renault	Modus	2004-2012	Yes	Needs extension cable	3	Yes	Very likely	at the bottom of center console



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Renault	Scenic	2004-2009	Yes	Needs extension cable	4	Yes	Very likely	under the cup holder
Renault	Scenic	2009-2016	Yes	Needs extension cable	4	Yes	Yes	under the cup holder
Renault	Scenic	2016-	Yes	Needs extension cable	4	Yes	Very likely	in the center console, undeer rear bootle holder
Renault	Talisman	2015-	Yes	Ok	2	Yes	Yes*	above driver kickpanel, under the dashboard
Renault	Trafic	2001-2014	Yes	Needs extension cable	1	Yes	Yes	under steering wheel
Renault	Trafic	2014-	Yes	Needs extension cable	1	Yes	Yes	left of steering wheel
Renault	Twingo	2004-2007	Yes	Ok	5	Yes	Very likely	in glove box
Renault	Twingo	2007-2014	Yes	Ok	5	Yes	Yes*	in glove box
Renault	Twingo	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel
Rolls-Royce	Wraith	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, under the dashboard
Rover	25	1999-2005	Contact Customer Support	Needs extension cable	1	No	Not supported	Above accelerator pedal
Saab	9-5	2004-2010	Yes	Needs extension cable	1	Yes	Very likely	Above accelerator pedal
Seat	Alhambra	2010-	Yes	Ok	1	No	Very likely	above driver kickpanel
Seat	Altea	2004-2015	Yes	Needs extension cable	1	Yes	Very likely	below steering wheel, near fuse box, behind dashboard cover
Seat	Exeo	2008-2013	Yes	Ok	1	No	Yes*	above kickpanel
Seat	Ibiza	2002-2008	Yes	Ok	1	Yes	Very likely	above kickpanel
Seat	Ibiza	2008-2015	Yes	Ok	1	Yes	Yes*	above kickpanel
Seat	Leon	1999-2005	Yes	Ok	3	Yes	Very likely	below air condition controls
Seat	Leon	2005-2011	Yes	Ok	1	Yes	Yes*	above kickpanel
Seat	Leon	2012-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Seat	Mii	2011-	Yes	Ok	2	No	Very likely	upper of driver kickpanel
Skoda	Citigo	2011	Yes	Ok	2	No	Very likely	upper of driver kickpanel



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Skoda	Fabia	1999-2007	Yes	Needs extension cable	1	Yes	Very likely	above kickpanel
Skoda	Fabia	2007-2014	Yes	Ok	1	Yes	Yes	above kickpanel
Skoda	Fabia	2014-	Yes	Ok	1	No	Yes*	above driver kickpanel, near bonnet release lever
Skoda	Karoq	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Skoda	Kodiaq	2017-	Yes	Ok	1	No	Yes*	above driver kickpanel, near bonnet release lever
Skoda	Octavia	2004-2013	Yes	Needs extension cable	1	No	Very likely	above driver kickpanel, near bonnet release lever, out of sight
Skoda	Octavia	2013-2017	Yes	Ok	1	No	Yes	above driver kickpanel
Skoda	Praktik	2007-2015	Yes	Ok	1	Yes	Very likely	above driver kickpanel
Skoda	Rapid	2012-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Skoda	Roomster	2007-2015	Yes	Ok	1	Yes	Yes*	above driver kickpanel
Skoda	Superb	2008-2015	Yes	Ok	1	No	Very likely	above driver kickpanel
Skoda	Superb	2015-	Yes	Ok	1	No	Very likely	above driver kickpanel
Skoda	Yeti	2009-2016	Yes	Ok	1	No	Yes*	above driver kickpanel
Smart	Forfour	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel
Smart	Fortwo	2004-2007	Contact Customer Support	ОК	2	No	Not supported	On the bottom of the storage compartment
Smart	Fortwo	2007-2014	Yes	Needs extension cable	1	Yes	Yes	above accelerator pedal
Smart	Fortwo	2014-	Contact Customer Support	Ok	1	Yes	Not supported	above accelerator pedal (left side)
Subaru	Forester	2004-2008	Yes	Ok	1	No	Very likely	above driver kickpanel
Subaru	Forester	2012-2018	Yes	Ok	1	No	Very likely	under driver knee bolster, left side
Subaru	Impreza	2016-	Yes	Ok	1	No	Very likely	under driver knee bolster, left side
Suzuki	Alto	2009-2015	Yes	Ok	1	No	Very likely	above accelerator pedal
Suzuki	Alto	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel, near center console
Suzuki	Baleno	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
				FIT				
Suzuki	Grand Vitara	2005-2015	Yes	Ok	1	No	Very likely	above driver kickpanel
Suzuki	Grand Vitara	2005-2015	Yes	Ok	1	No	Very likely	above driver kickpanel, near center console
Suzuki	Ignis	2004-2008	Yes	Ok	1	No	Very likely	above driver kickpanel
Suzuki	Swift	2005-2010	Yes	Ok	1	No	Very likely	above accelerator pedal
Suzuki	Swift	2010-2016	Yes	Ok	1	No	Very likely	above accelerator pedal
Suzuki	SX4	2006-2013	Yes	Ok	1	No	Very likely	above driver kickpanel
Suzuki	SX4	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Toyota	Auris	2006-2013	Yes	Ok	1	No	Yes	above driver kickpanel
Toyota	Auris	2013-2019	Yes	Ok	1	No	Yes	above driver kickpanel
Toyota	Avensis	2004-2008	Yes	Ok	1	Yes	Very likely	above driver kickpanel
Toyota	Avensis	2009-2018	Yes	Ok	1	No	Yes	above driver kickpanel
Toyota	Aygo	2005-2014	Yes	Ok	1	No	Yes*	above driver kickpanel
Toyota	Aygo	2014-	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	C-HR	2016-	Yes	Ok	1	No	Yes	above driver kickpanel, above the clutch
Toyota	Corolla	2004-2007	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	Corolla	2006-2013	Yes	Ok	1	No	Very likely	above driver kickpanel, above clutch
Toyota	Corolla	2014-2018	Yes	Ok	1	No	Very likely	above driver kickpanel, above clutch
Toyota	Corolla Verso	2004-2009	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	Hiace H200	2004-	Yes	Ok	1	No	Very likely	above driver kickpanel, above clutch
Toyota	HiLux	2015-	Yes	Ok	1	No	Very likely	above driver kickpanel, above clutch
Toyota	iQ	2009-2014	3	Ok	1	No	Very likely	above driver kickpanel
Toyota	Land Cruiser	2002-2009	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Toyota	Land Cruiser	2009-	Yes	Ok	1	No	Very likely	above drivers kickpanel
Toyota	MR2	2004-2007	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	ProAce	2016-	Yes	Needs extension cable	1	Yes	Yes*	above driver kickpanel, below steering wheel, near fuse, box, behind dashboard cover



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Toyota	RAV4	2004-2006	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	RAV4	2006-2013	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	RAV4	2013-2018	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	Verso	2009-2016	Yes	Ok	1	No	Yes*	above driver kickpanel
Toyota	Yaris	1999-2005	Yes	Ok	1	Yes	Very likely	in fuse box
Toyota	Yaris	2005-2011	Yes	Ok	1	No	Very likely	above driver kickpanel
Toyota	Yaris	2011-	Yes	Ok	1	No	Yes	above driver kickpanel
Vauxhall	Adam	2012-	Yes	Ok	1	No	Yes	above driver kickpanel
Vauxhall	Agila	2004-2007	Yes	Ok	1	No	Very likely	underside of the dashboard
Vauxhall	Astra	2004-2010	Yes	Ok	4	Yes	Yes	below handbrake cover
Vauxhall	Astra	2010-2015	Yes	Ok	1	No	Yes	above kickpanel
Vauxhall	Astra	2015-	Yes	Ok	1	No	Yes	above driver kickpanel
Vauxhall	Combo	2001-2011	Yes	Ok	3	No	Yes	middle console
Vauxhall	Combo	2011-2018	Yes	Needs extension cable	3	No	Yes	above driver kickpanel, next to steering wheel, near fuse box, behind dashboard cover
Vauxhall	Combo	2018-	Yes	Needs extension cable	1	Yes	Yes*	under driver knee bolster removed panel, panel don't close with link. Extension cable needed.
Vauxhall	Corsa	2004-2006	Yes	Ok	3	No	Very likely	middle console
Vauxhall	Corsa	2006-2014	Yes	Ok	3	No	Yes	middle console
Vauxhall	Corsa	2014-	Yes	OK	1	No	Yes	above driver kickpanel, above the clutch
Vauxhall	Crossland X	2017-	Yes	Ok	1	No	Very likely	under driver knee bolster, left side
Vauxhall	Grandland X	2017-	Yes	Needs extension cable	1	Yes	Very likely	under driver knee bolster removed panel, on the right side
Vauxhall	Insignia	2008-2017	Yes	Ok	1	No	Yes	above driver kickpanel, above the clutch
Vauxhall	Insignia	2017-	Yes	OK	1	No	Yes	above driver kickpanel, above the clutch
Vauxhall	Meriva	2004-2010	Yes	Ok	4	Yes	Very likely	below the handbrake cover
Vauxhall	Meriva	2010-	Yes	Ok	4	Yes	Very likely	between gearshift lever and handbrake



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Vauxhall	Mokka	2012-2019	Yes	Ok	1	No	Very likely	above driver kickpanel, near bonnet release lever
Vauxhall	Movano	2010-	Yes	Needs extension cable	1	Yes	Very likely	below steering wheel, behind dashboard cover
Vauxhall	Tigra TwinTop	2004-2009	Yes	Ok	3	No	Yes	center console, below air condition controls, next to cigarette lighter adapter (CLA)
Vauxhall	Vectra	2004-2009	Yes	Needs extension cable	3	Yes	Very likely	under the ashtray
Vauxhall	Viva	2015-	Yes	Ok		No	Very likely	Under the dashboard, driver side. At the left of the pedals near footrest
Vauxhall	Vivaro	2001-2014	Yes	Needs extension cable	1	Yes	Yes*	under steering wheel
Vauxhall	Vivaro	2014-	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel, next to steering wheel, near fuse box, behind dashboard cover
Vauxhall	Zafira	1999-2005	Yes	Ok	4	Yes	Very likely	below the handbrake cover
Vauxhall	Zafira	2005-2014	Yes	Needs extension cable	4	Yes	Yes	between gearshift lever and handbrake. Cover cannot be fully closed with device attached
Vauxhall	Zafira Tourer	2014-	Yes	Ok	1	No	Yes	above driver kickpanel, near bonnet release lever
Volkswagen	Amarok	2010-	Yes	Ok	1	No	Yes*	above driver kickpanel
Volkswagen	Arteon	2017	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Beetle	2011-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Caddy	2004-2015	Yes	Needs extension cable	1	Yes	Yes	behind dashboard cover
Volkswagen	Caddy	2015-	Yes	Needs extension cable	1	Yes	Yes	behind dashboard cover
Volkswagen	СС	2012-2016	Yes	Ok	1	No	Yes*	above driver kickpanel, above the clutch
Volkswagen	Crafter	2006-2016	Yes	Needs extension cable	1	Yes	Yes	above driver kickpanel
Volkswagen	Crafter	2017-	Yes	Ok	1	No	Yes	above driver kickpanel, to the left, under the dashboard
Volkswagen	EOS	2006-2015	Yes	Ok		No	Very likely	above driver kickpanel, near bonnet release lever
Volkswagen	Fox	2005-2011	Yes	Needs extension cable	1	Yes	Very likely	behind dashboard cover
Volkswagen	Golf	2003-2008	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Golf	2008-2012	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Golf	2012-	Yes	Ok	1	No	Yes	above driver kickpanel



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Volkswagen	Golf Plus	2004-2008	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Golf Plus	2008-2014	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Golf Variant	2007-2009	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Golf Variant	2009-2013	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Golf Variant	2013-	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Volkswagen	Jetta	2005-2010	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Jetta	2010-2018	Yes	Ok	1	No	Very likely	above driver kickpanel, above the clutch
Volkswagen	Passat	2005-2010	Yes	Ok	1	No	Yes*	above driver kickpanel
Volkswagen	Passat	2010-2014	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Passat	2014-	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Passat CC	2008-2012	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Polo	2005-2009	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Polo	2009-2014	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Polo	2014-2017	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Polo	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Scirocco	2008-2016	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Sharan	2010-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Tiguan	2007-2016	Yes	Ok	1	No	Yes*	above driver kickpanel
Volkswagen	Tiguan	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Touareg	2002-2010	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Touareg	2010-2018	Yes	Ok	1	No	Yes*	above driver kickpanel
Volkswagen	Touareg	2018-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Touran	2006-2010	Yes	Needs extension cable	1	Yes	Very likely	behind oddments box
Volkswagen	Touran	2010-2015	Yes	Ok	1	Yes	Yes*	below steering column



MAKE	MODEL	MODEL YEARS	SUPPORTED	MECHANICAL FIT	PORT LOCATION	PORT COVERED	FUEL CONSUMPTION	COMMENT
Volkswagen	Transporter	2003-2009	Yes	Ok	1	No	Yes*	above driver kickpanel, near bonnet release lever
Volkswagen	Transporter	2009-2015	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	Transporter	2015-2019	Yes	Ok	1	No	Yes	above driver kickpanel
Volkswagen	T-Roc	2017-	Yes	Ok	1	No	Very likely	above driver kickpanel
Volkswagen	Up!	2011-	Yes	Ok	1	No	Yes*	above drivers kickpanel
Volvo	C30	2006-2013	Yes	Ok	1	No	Yes	underside of dashboard
Volvo	C70	2006-2013	Yes	Ok	2	No	Very likely	above driver kickpanel, underside of dashboard, left of steering column
Volvo	S40	2004-2012	Yes	Ok	2	No	Very likely	underside of dashboard
Volvo	S60	2004-2010	Yes	Needs extension cable	1	Yes	Very likely	underside of dashboard
Volvo	S60	2010-2018	Yes	Ok	1	No	Yes*	underside of dashboard
Volvo	S80	2006-2016	Yes	Ok	1	No	Very likely	above driver kickpanel, underside of dashboard, left of steering column
Volvo	S90	2016-	Yes	Ok	1	No	Very likely	above driver kickpanel, near fuse box, above the clutch
Volvo	V40	2012-2019	Yes	Ok	1	No	Yes	underside of dashboard
Volvo	V50	2004-2012	Yes	Ok	1	No	Very likely	underside of dashboard
Volvo	V60	2010-2018	Yes	Ok	2	No	Yes*	underside of dashboard
Volvo	V70	2004-2007	Yes	Needs extension cable	1	Yes	Very likely	left side
Volvo	V70	2007-2016	Yes	Ok	1	No	Very likely	underside of dashboard
Volvo	XC40	2017-	Yes	Ok	1	No	Very likely	under driver knee bolster, left side
Volvo	XC60	2008-2016	Yes	Ok	1	No	Yes*	underside of dashboard
Volvo	XC60	2016-	Yes	Ok	1	No	Yes	above driver kickpanel, near fuse box, above the clutch
Volvo	XC70	2007-2016	Yes	Needs extension cable	1	Yes	Yes*	left side
Volvo	XC90	2004-2015	Yes	Needs extension cable	1	Yes	Yes*	left side
Volvo	XC90	2015-	3	Ok	1	No	Very likely	left side



Thank You Any questions?



a Bridgestone company

